

## **SealSmart II™ Instructions**


PLATINUM TOOLS®

©2010 Platinum Tools Inc. All rights reserved. TS 11/14

- 1) Strip & prep cable (refer to the connector's instructions).
- 2) Open your tool all the way.
- 3) Insert cable into the compression sleeve support (Fig A) & slide the connector up into the adapter head. (Fig B).
- 4) Rotate/adjust adapter head until the width of the cable jacket between the compression sleeve support & the end of the connector matches the width of the compression sleeve (Fig B).
- 5) Squeeze/close tool until fully closed.
  NOTE: Adjust adapter head accordingly for over or under crimped results.
- 6) Once dialed in, set the lock washer (Fig C) to maintain the required setting.

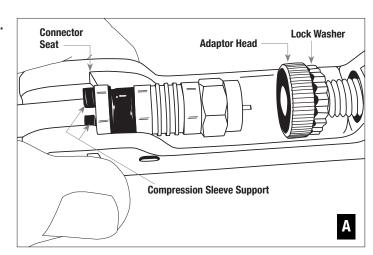

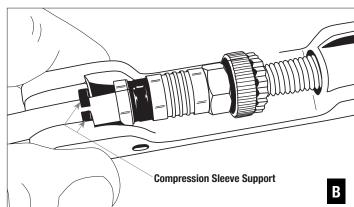

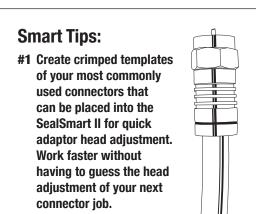

#2 If connector is too long to fit into SealSmart II with adaptor head wide open, remove lock washer for additional space.

