


Instruction Sheet

SealSmart Coaxial Cable Strippers

SealSmart
IS15024

Cable Stripping & Termination

1. Remove compression sleeve from rear of connector and slide onto cable before cable stripping.
2. Open tool and place cable in tool. Close tool.
3. Using forefinger, rotate tool around cable 4-5 times.
4. Grasp jaws of tool with thumb & forefinger, hold closed.
5. Pull stripper straight off end of cable while holding closed.
6. Remove stripped cable & dielectric from jaws of tool.
7. Trim center conductor to proper length 3/16".
8. If using SealSmart Compression connector, fold braid back over cable jacket prior to insertion into connector.

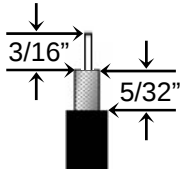


No adjustments required!

Cable	Tool Color	P/N
RG59 Mini 23AWG	Mustard Yellow	15024

© Platinum Tools, Inc. 2008

SealSmart
Compression Connectors

IS15024

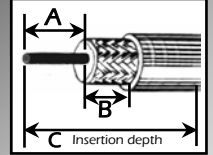

Color Code		Connec- tor Type	Stripping Dimensions		
Cable	Color		A	B	C
RG59 Mini 23AWG	Blue	'F'	5/16"	5/32"	N/A
		RCA	3/16"	5/32"	3/4"
		BNC	3/16"	5/32"	3/4"



© Platinum Tools, Inc. 2008

PLATINUM TOOLS
www.platinumtools.com Ph: 805.532.0145